
**A Study on Meeting the 3% Allowable Reject Rate in Producing Best Food
Real Mayonnaise 1kg at Unilever Philippines Inc.**

A Practicum Study Presented to the Faculty of the
College of Engineering Architecture and Technology

De La Salle University – Dasmariñas

Dasmariñas, Cavite

In Partial Fulfillment
of the Requirements for the Degree of
Bachelor of Science in Industrial Engineering

Submitted By:

LARGA, Rowie Rose C.

IEE52

Submitted To:

Engr. Ma. Estrella Natalie B. Pineda

March 2014

ABSTRACT

This study is related in the field of Quality Control. The research is conducted at Unilever Philippines Inc. located at Gateway Business Park Javalera Gen. Trias Cavite. The observation is done in the production of Best Food Real Mayonnaise 1kg where the researcher were assigned for her Practicum. Through interview and gathering of data from some of the staff in the production, the problem is identified. The company has experienced 11.02% Reject Rate in the production of Best Food Real Mayonnaise 1kg from the month of July 2013 to December 2013 amounting to PHP 1,105,845. Thus, exceeding the 3% allowable reject rate of the company. The root causes of the problems were also determined in this study such as defective materials from the supplier, not following the procedures and guidelines provided by the company and corrective maintenance. After determining the root cause of the problems, the researcher proposed alternative courses of action to prevent the occurrence of such problems. When alternative courses of action are implemented objectives of the study will be achieved.

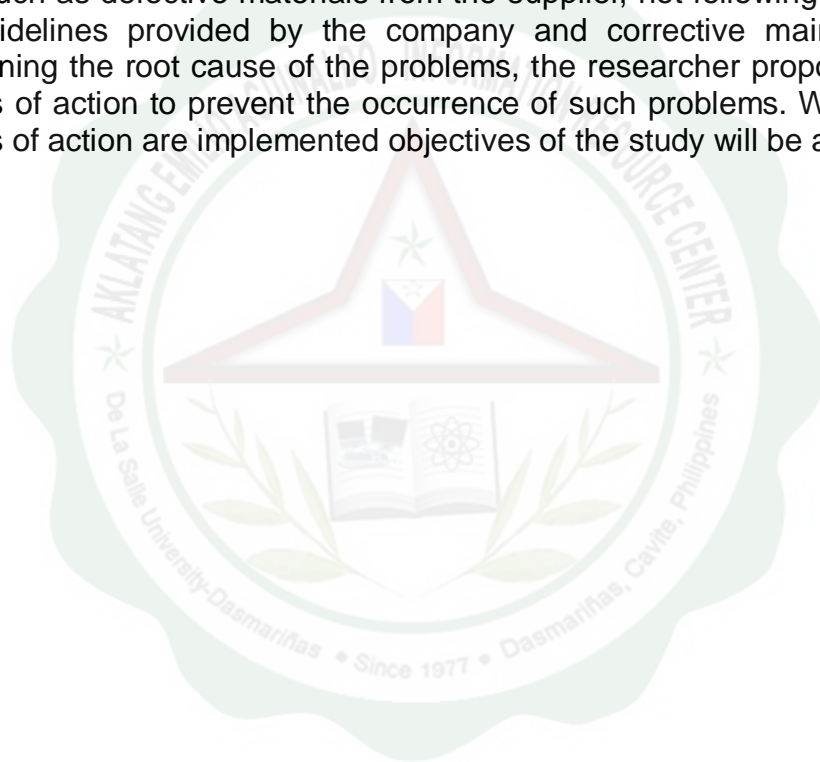


TABLE OF CONTENTS

Approval Sheet	i
Abstract	ii
Acknowledgements	iii
Table of Contents	iv
Table of Figures	v
CHAPTER 1: INTRODUCTION	
Introduction	1
Background of the Study	3
Problem Statement	4
Objectives of the Study	4
Significance of the Study	5
Scope and Limitation	6
Methodology of the Study	6
Definition of Terms	7

CHAPTER 2: REVIEW OF RELATED LITERATURE

Productivity in Manufacturing Industry	9
Filling Machine as an Important Packaging Tasks in Industries.....	10
Mayonnaise	11
Mayonnaise-Based Salads Composition	12
Emulsion.....	13
Factors to Consider for a Proper Emulsion.....	14
Mayonnaise Spoilage Myths.....	14
Study on an Innovative PET Packaging for Mayonnaise	15

CHAPTER 3: DATA AND ANALYSIS

Total of Rejects at Line B.....	18
Working Hours.....	19
Computations	20
Check Sheet Report	21
Why-Why Analysis.....	22
Summaries of Reject caused by Black Spot.....	23

Summaries of Reject caused by Air Pocket.....	24
Summaries of Reject caused by Damaged Label.....	25
Summaries of Reject caused by Under Fill/ Overfill.....	26
Summaries of Reject caused by FOM.....	27
Pareto Analysis.....	28
Pareto Diagram	28
Process Flow Chart.....	29
Summary of Types of Rejects.....	30
Fishbone Diagram	31
Sample Picture of Rejects	32
Sample of Proper and Improper wearing of Hairnet	34
Record of Sealing Machine Downtime.....	35
Standard Time for Capping.....	35
Standard Procedure	36
Problem Tree.....	37
Problem Tree Analysis Cause.....	38
Problem Tree Analysis Effects	39

Objective Tree	40
Objective Tree Analysis Means.....	41
Objective Tree Analysis Ends	42

CHAPTER 4: ALTERNATIVE COURSE OF ACTION

A.C.A NO. 1 Revise Agreement with the Supplier	43
A.C.A NO. 2 Set Disciplinary Actions to the Workers.....	50
A.C.A NO. 3 Preventive Maintenance.....	53
Cost Benefit Analysis.....	57

CHAPTER 5: CONCLUSION AND RECOMMENDATION

Conclusion.....	58
Recommendation	59

CHAPTER 6: DETAILED PLAN OF ACTION

Gantt Chart.....	60
Detailed Plan of Action	61

BIBLIOGRAPHY 63

APPENDICES 67



TABLE OF FIGURES

TABLES

Table 3.1 Total of Rejects at Line B	18
Table 3.2 Working Hours in Producing the Best Food Real Mayo 1KG	19
Table 3.3 Check Sheet Report.....	21
Table 3.4 Why-Why Analysis	22
Table 3.5 Summaries of Reject caused by Black Spot	23
Table 3.6 Summaries of Reject caused by Air Pocket	24
Table 3.7 Summaries of Reject caused by Damaged Label	25
Table 3.8 Summaries of Reject caused by Under Fill/ Overfill	26
Table 3.9 Summaries of Reject caused by FOM.....	27
Table 3.10 Pareto Analysis	28
Table 3.11 Summary of Types of Rejects.....	30
Table 3.12 Record of Sealing Machine Downtime	35
Table 3.13 Standard Time for Capping	35
Table 3.14 Standard Procedure Provided by the Company	36

FIGURES

Figure 3.1 Root Cause Analysis for Black Spot	23
Figure 3.2 Root Cause Analysis for Air Pocket	24
Figure 3.3 Root Cause Analysis for Damaged Label	25
Figure 3.4 Root Cause Analysis for Under Fill / Overfill	26
Figure 3.5 Root Cause Analysis for FOM	27
Figure 3.6 Pareto Diagram	28
Figure 3.7 Process Flow Chart	29
Figure 3.8 Fishbone Diagram	31
Figure 3.9 Sample Picture of Rejects	32
Figure 3.10 Sample of Proper and Improper Wearing of Hairnet.....	34